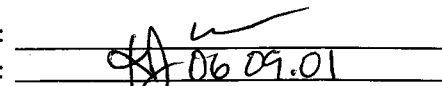
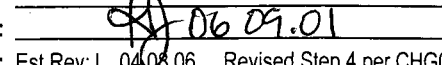


Date: Friday, 9/1/2006 12:01:38 PM  
 User: Kim Johnston

## Process Sheet

<b>Customer</b>	: CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b>	: 206 A/B HIGH GEAR SKIDTUBE
<b>Job Number</b>	: 28383		
<b>Estimate Number</b>	: 10161		
<b>P.O. Number</b>	: N/A	<b>Part Number</b>	: D206642211
<b>This Issue</b>	: 9/1/2006	<b>S.O. No.</b>	: N/A
<b>Prsht Rev.</b>	: NC	<b>Drawing Number</b>	: N/A
<b>First Issue</b>	: N/A	<b>Project Number</b>	: N/A
<b>Previous Run</b>	: 28382	<b>Drawing Revision</b>	: N/A
	<b>Type</b> : LANDING GEAR	<b>Material</b>	: N/A
<b>Written By</b>	: 	<b>Due Date</b>	: 9/20/2006
<b>Checked &amp; Approved By</b>	: 	<b>Qty:</b>	1
<b>Comment</b>	: Est Rev:J 0408.06 Revised Step 4 per CHG003 KJ/JLM J 0 4.08.06		

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP206-642-211 CHG004

K-8 06-09-06 (1)

2.0	28383A	HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
-----	--------	-------------------------------------

**Comment:** Sub-Component HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

D206-642-241 B 28383A

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------

**Comment:** PACKAGING RESOURCE #1

Pick Packing Kit

4.0	D206651041	206 A/B GHW Kit
-----	------------	-----------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D206-651-041 GHW Kit

B24197 U

5.0	D2652	Bushing
-----	-------	---------

**Comment:** Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

16 D2652

Bushing

B28252 ✓

P/B 06/4/09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:01:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28383

Part Number: D206642211

Job Number:



Seq. #: Machine Or Operation: Description :

6.0 D2655 Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

1 D2655 Tow Ring B27110 ✓

7.0 D26651 Saddle, LH Fwd Aft Out



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2665-1 Saddle B284042, ✓ ~~B25980~~ × 1 <sup>13</sup>

8.0 D26661 Saddle, LH, Fwd, Aft, In



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

2 D2666-1 Saddle B25916 ✓

*comp shows on 1 left for that BATCH*

9.0 D2712 Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part Number Description Batch

10 D2712 Set Screw B26481 ✓

10.0 D2884 Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

SADDLE SPACER

Batch: B25982 ✓

11.0 D2885 Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Saddle Spacer

B23926 ✓ *B06/11/09*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:01:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28383

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

AN341A

Bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN3-41A

Bolt

M102339 ✓

13.0

AN45A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

1 AN4-5A

Bolt

M100857 ✓

14.0

AN46A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 AN4-6A

Bolt

M101418 ✓

15.0

AN57A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-7A

Bolt

M102440 ✓

16.0

AN511A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN5-11A

Bolt

M102404 ✓

17.0

AN644A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 AN6-44A

Bolt

M100447 ✓

B 06/11/09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 9/1/2006 12:01:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28383

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN960JD10

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD10

Washer M100743 ✓

19.0

AN960JD416

Washer



Comment: Qty.: 25.0000 Each(s)/Unit Total : 25.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

25 AN960JD416

Washer M102339 ✓

20.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 AN960JD516

Washer M102328 ✓

21.0

AN960JD616

Washer



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

4 AN960JD616

Washer M101124 ✓

22.0

MS21042L3

Nut



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

8 MS21042L3

Nut (or -3) M101917 ✓

*PRB 11/10/09*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 06/11/10

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Friday, 9/1/2006 12:01:39 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 A/B HIGH GEAR SKIDTUBE

Job Number: 28383

Part Number: D206642211

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

MS21042L4

Nut



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

12 MS21042L4

Nut (or -4)

H19185 ✓

24.0

MS21042L6

Nut



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick: Packing Kit

Qty Part Number

Description Batch

2 MS21042L6

Nut (or -6)

H10015H ✓

PS 06/11/09

25.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

PS 06/11/10 (1)

26.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-211

Location:

Re U D

PS 06/11/10 (1)

27.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

PS 06/11/10 (1)

Job Completion



U 26.11.10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:43 PM  
User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B  
Job Number : 28383A  
Estimate Number : 10163  
P.O. Number : NIA Part Number : D206642241  
This Issue : 9/1/2006 S.O. No. : NIA Drawing Number : D2650 REV E P1,3  
Prsht Rev. : NC Project Number : N/A  
First Issue : NIA Type : LANDING GEAR Drawing Revision : E  
Previous Run : 28382A Material : NIA  
Written By : Due Date : 9/20/2006 Qty: 1 Um: Each  
Checked & Approved By : 06-09-01  
Comment : Est Rev:M 04.12.02 Revised procedural steps KJ/JLM

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D206-642-241 CHG003

06-09-06

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
1 D2620 Bent Tube 3" OD B27831

DP 6-9-5

3.0 D32861 Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch  
2 D3286-1 Doubler B27594

BE 06-10-06

4.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
1 D2647 Fwd Cap B24400

B 24842 BE 06-09-06

5.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

DP 6-9-5

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP 6-9-5

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

BE 6-9-6

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M101655/M101010

4-Grind weld flush to cap on top surface only.

fm 06-9-2001

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

fm 06-9-2001

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

DP 6-9-28

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

BE 06-10-06

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

BE 06-10-06

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

BE 06-10-06

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

BE 06-10-06

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

BE 06-10-06

14-Remove indexing edge using DT8741 as per Dwg D2650

BE 06-10-11

15-C'sink GHW rivet holes as per Dwg D2650

BE 06-10-11

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

700-10-17 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

*BE 06-10-18*

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

*m.r 06/10/19*

*①*

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*Pm'06-10-23①*

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

*Pm'06-10-23①*

*Pm'06-10-23①*

*Pm'06-10-23①*

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

*BE 06-10-23 ①*

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total : 52.0000 Each(s)

Pick:

Qty Part Number

Description Batch

52 CR3212-4-04

Rivet

*M102049 Pm'06-10-23 ⑤2*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Friday, 9/1/2006 12:02:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

206 I-Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2654-3

Web

B29008 Pm 06-10-23 (1)

14.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

Pm 06-10-23 (1)

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 06-10-23 Time: 11:45 am

Finish Date: 06-10-24 Time: 11:30 am

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

M102107

Sikaflex expire date:

07-02-01

Pm 06-10-23 (1)

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 06-10-24

16.0

D2649

Crossbolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description Batch

18 D2649

Crossbolt spacer

B28250 BE 06-10-24

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D3286-3

Spacer

B24711 BE 06-10-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:43 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M101010 / M101055 BE 06-10-24

2-Grind welds flush as per Dwg D2650.

Pm 06-10-24 (1)

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

~~ARSS Rod~~ NONE USED BE 06-10-27

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

Pm 06-10-27 (1)

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets M101938 Pm 06-10-27 (2)

20.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 M7885/3-4-3 Rivets M19099 Pm 06-10-27 (2)

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate B24203 Pm 06-10-27 (1)

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Friday, 9/1/2006 12:02:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

*Pm 06-10-270*

23.0

QC5/9

WELD INSPECTION



Comment: Inspect weld and Counterbore work to Current Step. Inspect for foreign objects as per QSI 024

*06/01/300*  
*06/10/270*

24.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

*PC 06-11-07*

*06/11/07*

*x1*

*M101575*

25.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*06/11/09*

26.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

*27169*

27.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

*27739*

28.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

*27075*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

29.0	D265633	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2656-33	Wearshoe	28179

30.0	D34291	
------	--------	--



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D3429-1	Wearpad	B29201

31.0	ALS41032130	Insert
------	-------------	--------



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	ALS4-1032-130	Inserts	18990

or (see QSI 017)

32.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN960JD10L	Washer	100233

33.0	MS27039108	Screw
------	------------	-------



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	MS27039-1-08	Screw	102404

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Friday, 9/1/2006 12:02:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

34.0	D26511	Plug
------	--------	------



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2651-1 Plugs 28691

35.0	D26513	O-Ring
------	--------	--------



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2651-3 O-Rings 28401

36.0	MS27039406	Screw
------	------------	-------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 MS27039-4-06 Screw 6874

37.0	AN960JD416	Washer
------	------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960JD416 Washer 11151

38.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

Sikaflex expire date:

102107

02/07

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

*[Signature]*  
06/11/07

*[Signature]*  
06/11/07

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP  
Inspect for foreign objects as per QSI 024

FC 06 11 07 ①

40.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
1 D2646 Aft Cap 28041

41.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
2 MS27039-1-08 Screw 102404

42.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)  
Pick:  
Qty Part Number Description Batch  
2 AN960JD10L Washer 100233

43.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive  
A/R Sikaflex-291 107107  
Sikaflex expire date: 02/07

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4  
Batch: M102098

a.m

06/11/07

①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 9/1/2006 12:02:44 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 28383A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

44.0

QC3/5

INSPECT WORK/WING WALK



Comment: INSPECT WORK/WING WALK

*Doc 11/03 (1)*

45.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location: \_\_\_\_\_

PPP Rev: \_\_\_\_\_

*M/A Doc 4/4/09*

46.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

*Doc 11/10 (1)*

Job Completion



*U Doc 11/10*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

**DART**

DESIGN <i>14</i>	DRAWN BY <i>14</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2650	REV. E SHEET 1 OF 5
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES	SCALE NTS
A	97.03.25	NEW ISSUE	
B	97.06.26	AS MANUFACTURED CHANGES	
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END	
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3	
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER	

RELEASED

16 04 17 *PH*

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET



**NOTES**

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 6 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH:  
-CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED


SHOP COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 28383A

**Copyright © 1997 by DART AEROSPACE USA, INC.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

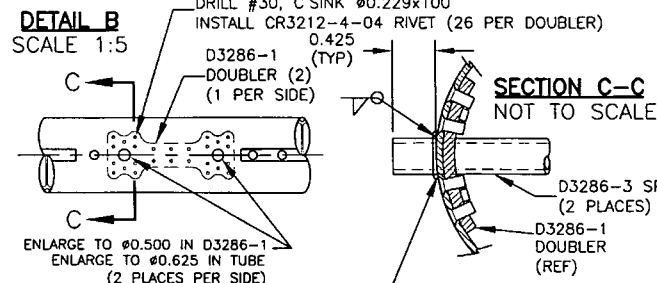
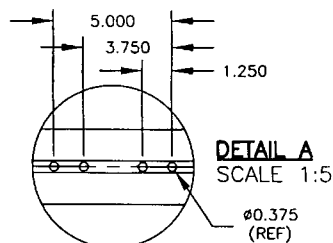


- TO INSTALL D3286-1/-3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
  2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
  3. ENLARGE HOLES IN D3286-1 TO Ø0.500
  4. ENLARGE HOLES IN TUBE TO Ø0.625 AND CHAMFER HOLE 0.030x45°
  5. RIVET D3286-1 TO TUBE
  6. INSERT D3286-3 SPACER
  7. WELD IN PLACE AND GRIND FLUSH

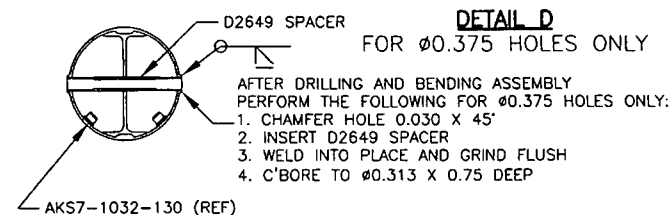

RELEASED



06.04.07

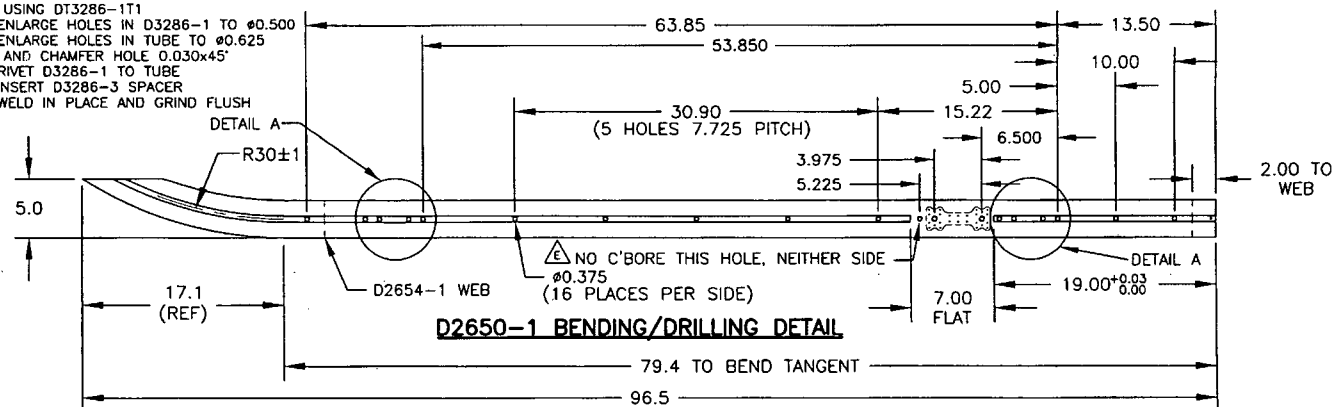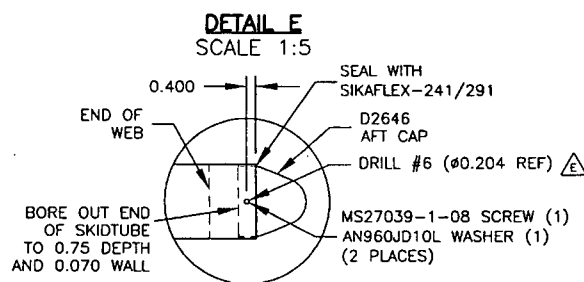

#### DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

 NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

 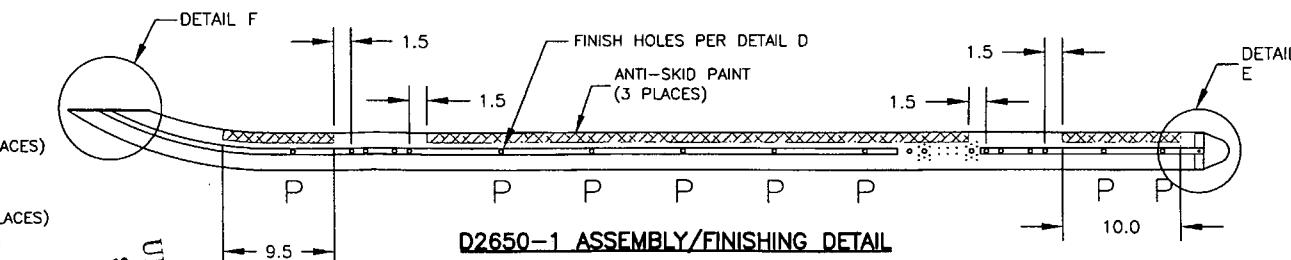



 



COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.







THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	AP	DRAWN BY	IP	<b>DART</b> DART AEROSPACE USA, INC.
CHECKED	PH	APPROVED	H	PORT HADLOCK, WA
DATE	06.03.30	DRAWING NO.	D2650	REV. E
		TITLE	SKIDTUBE	SHEET 2 OF 5
				SCALE 1:10



COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.  THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	DESIGN <i>UP</i>	DRAWN BY <i>UP</i>	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	REV. E
	CHECKED <i>PH</i>	APPROVED <i>[Signature]</i>	DRAWING NO. <b>D2650</b>	SHEET 3 OF 5
DATE <b>06.03.30</b>	TITLE <b>SKIDTUBE</b>		SCALE 1:10	

 COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.	DESIGN 	DRAWN BY 	 DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	CHECKED 	APPROVED 	DRAWING NO. D2650	REV. E SHEET 4 OF 5
	DATE 06.03.30		TITLE SKIDTUBE	1:10

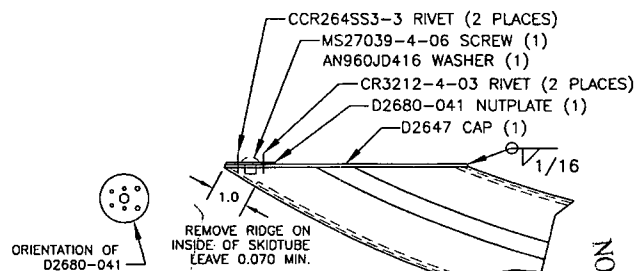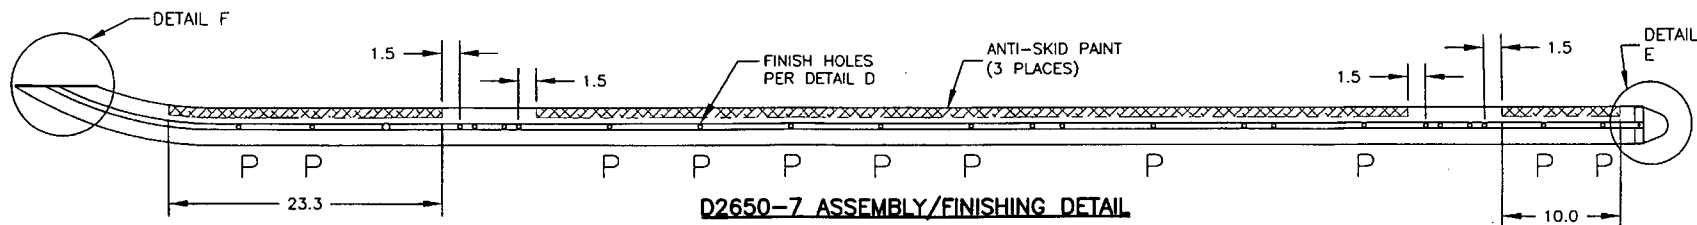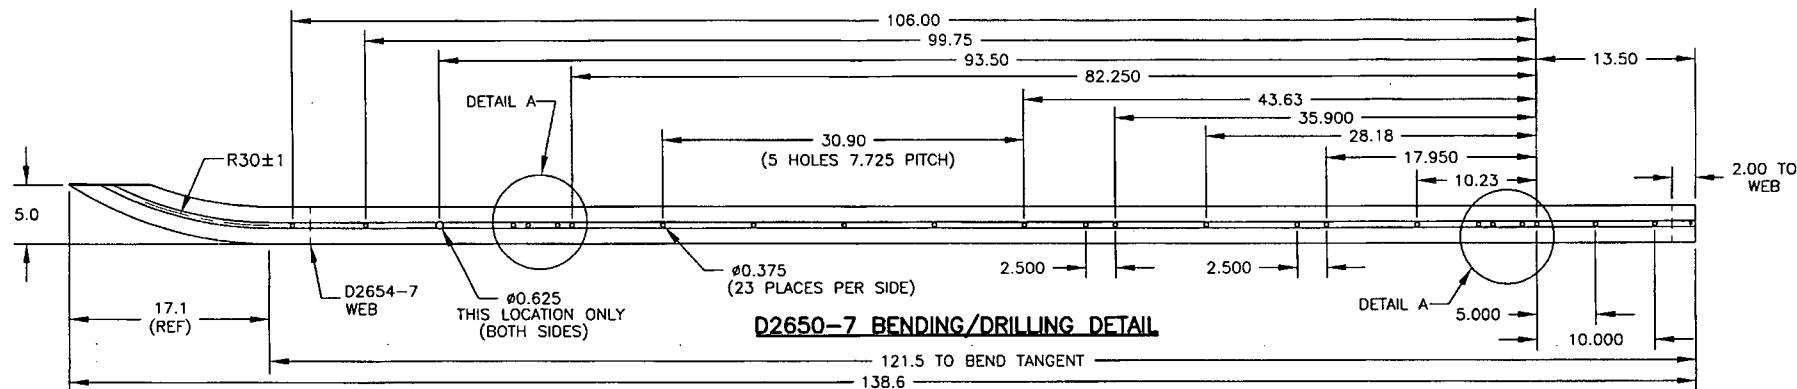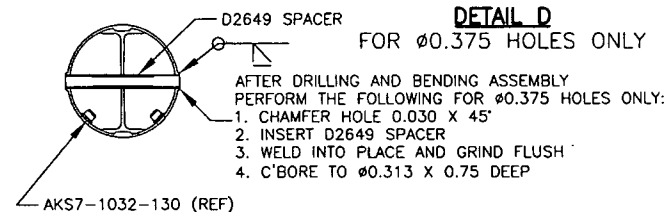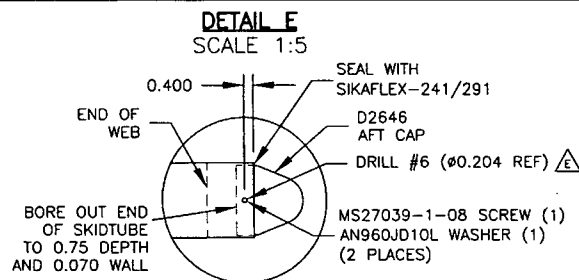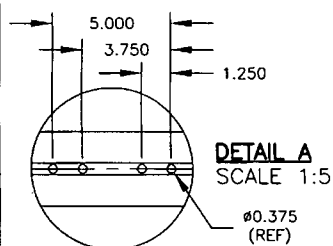

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
  2. REMOVE RIDGE ON FWD SIDE
  3. LOCATE D2647 (TRIM AS NECESSARY)
  4. WELD D2647 IN PLACE PER DART QSI 004
  5. GRIND FLUSH
  6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

NO. 48383A  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
CONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHIP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	CP	DRAWN BY	CP	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, MA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	CH	DRAWING NO. D2650	REV. E SHEET 5 OF 5
		DATE	06.03.30	TITLE SKIDTUBE		SCALE 1:10	

RELEASED  
a.v.n. #



NO. 38

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name Barclay Elliott  
Joint Welding Procedure Tig  
Part number and Job number A206642241 / B28155A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position		Vertical Down <input type="checkbox"/> Up <input type="checkbox"/>	
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input checked="" type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐

Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/10/23

Qualifier Dan D. Swal